



## Note on changing the oil filter

to fit

AZQ, BME, BZG

Seat Ibiza 1.2, Cordoba 1.2

Škoda Roomster 1.2, Fabia I/II 1.2

VW Fox 1.2, Crosspolo 1.2, Polo 1.2

### PROBLEM

Rattling noises from the drive chain which can cause engine damage in the worst case scenario. The chain tensioner is the main problem.

### CAUSE


The chain tensioner is not fitted with a non-return valve. As a result, the chain tensioner is emptied completely when the old oil is drained off due to the lack of oil pressure. The manufacturer even recommends changing the oil filter before draining off the oil.

### SOLUTION

Once refilled with new oil, pressure has to be built up again first in the oil circuit. To do this, the engine and starter have to be turned over once (without starting the engine). This starts the oil pump feeding oil and builds the oil pressure back up again.

### ATTENTION

Comply with the manufacturer's instructions!

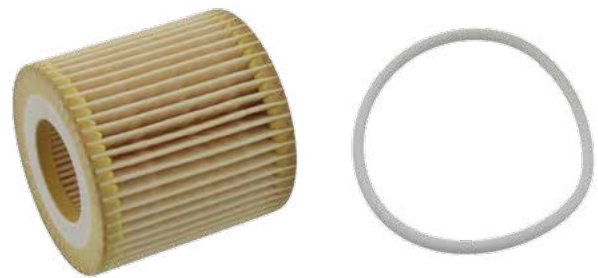

**SWAG no. 30 92 3468**

Repl. no. 03D 198 819 A

Register now for the official SWAG newsletter and receive the latest technical information automatically by email!

Further information may be obtained at: [partsfinder.bilsteingroup.com](http://partsfinder.bilsteingroup.com)