

SWAG 30 94 4945

to fit:

Audi, Seat, Skoda, Volkswagen, Mitsubishi,
various models

1.9 & 2.0 TDi Engines

SWAG[®]

EN

Throttle Body

PROBLEM

Engine management lamp illuminated, poor performance, increased engine temperature and/or engine shuddering during switch off. Fault codes logged relating to the throttle body, intake manifold flap and coolant fan motor.

CAUSE

The above symptoms can be caused by an excessive build-up of carbon deposits, failed throttle body drive components or a seized throttle plate. This results in a blown fuse which protects both the cooling fan and throttle body circuits.

SOLUTION

Check and rectify all circuits relating to the faulty component and replace throttle body.

For more technical information please visit: partsfinder.bilsteingroup.com