



To Fit:

FWD Ford Transit, Tourneo
Engine 2.2-litre TDCI Duratorq



EN

Crankshaft Pulley

Problem

Typical problems include: Abnormal noise and vibration from the timing belt area; Alternator warning lamp illuminated; Power steering belt damaged or has come off the pulley.

Cause

Over time, water and road debris ingress into the torsional vibration damper crankshaft pulley, causing premature wear and the failure of the crankshaft pulley and auxiliary drive belt system.

Solution

Replace the crankshaft pulley with SWAG 50 93 6626 which includes all of the necessary bolts. All damaged or worn auxiliary drive belts should also be replaced.