

KB655.07/UK/01 - 07/2014

SUSPENSION



KB655.07 Installation information

20

000-00-6

NISSAN: Kubistar RENAULT: Clio (II, II FL, Campus Evolution), Kangoo (Extra, I and I FL), Thalia FL, Twingo (II and II FL), Symbol - Thalia

OE reference 54310-00QAA 543A00300R

IDENTIFICATION OF THE SUSPENSION BEARING KIT NTN-SNR KB655.07








INSTALLATION ORIENTATION PROBLEM

• If the suspension bearing is installed backwards into the insulator, it will impede the rotation of the steering system.

INSTALLATION ORIENTATION OF SNR BEARING AP.40016.S01

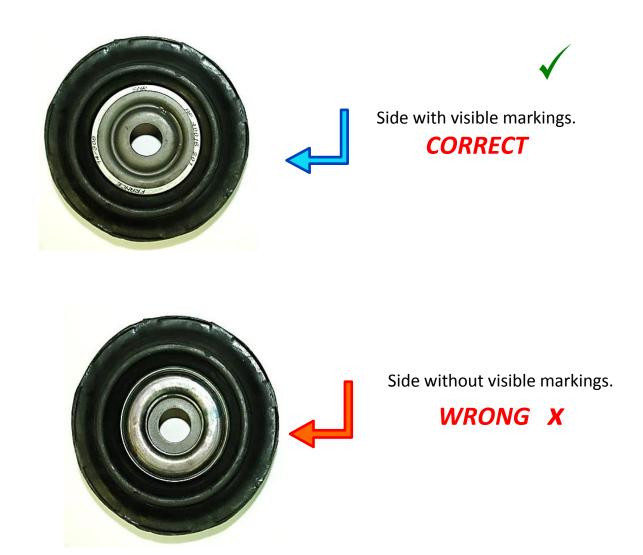

MISSING PARTS PROBLEM

• All parts supplied in the kit must be fitted in the correct orientation, failure to fit all the parts supplied in kit KB655.07 will weaken the entire suspension unit.


Missing or incorrectly fitted parts causes premature bearing wear, this has an impact on all of the other suspension components.







All parts supplied in kit KB655.07 must be used and correctly installed. A small amount of play between the upper shock mount and the recoil retainer is normal.

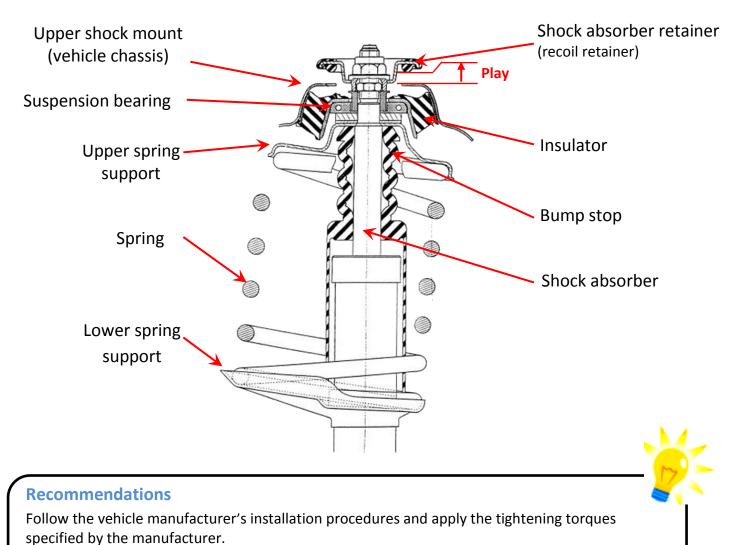

We recommend replacing suspension bearing kits in pairs.

Refer to the vehicle applications in our online catalogue: eshop.ntn-snr.com

