Blue Print ADT37025, ADT37039, ADT37063



Toyota Rav4 2.0VVTi (Models ACA20/21 - 1AZ-FE)




TOYOTA RAV4 - OXYGEN SENSOR POSITION IDENTIFICATION FROM FAULT CODES

The Toyota Rav4 2.0VVTi models built between May 2000 and July 2003 (model types ACA20 and ACA21) are fitted with four oxygen sensors. Two pre-cat and two post-cat.

These appear in the partsfinder catalogue as LH/RH and Upper/Lower sensors.

Most diagnostic equipment and repair manuals will refer to these sensors as Sensor 1/Sensor 2 and Bank 1/Bank 2.

e.g. P0057 - Bank 2 Sensor 2 heater circuit malfunction

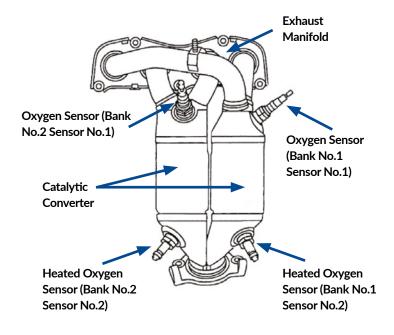

To help select the correct Blue Print sensor you will need to know the following information:

Bank 1 = LH

Bank 2 = RH

Sensor 1 = Upper

Sensor 2 = Lower

Therefore, a 'Bank 2 Sensor 2' fault code is referring to a problem relating to the 'RH Lower' oxygen sensor circuit.

When one of these oxygen sensors fails, the obligatory engine management warning light (MIL) will come on.

INF121_12 | Technical data can be subject to change | March19