

## VW325R DRIVESHAFT INSTALLATION ADVICE




## VW325R Driveshaft

These Driveshafts are designed to OE specifications and premature failure may occur on applications with modified suspension and or ride heights

The inner joint of the driveshaft has a working range of up to 16°, under normal operation this will not be exceeded.

However, if the joint is unsupported on fitment and exceeds 22° there is a risk of the inner joint becoming dislocated, it is recommended that on handling that the driveshaft is supported sufficiently to unsure the inner CV joint does not exceed 22°.

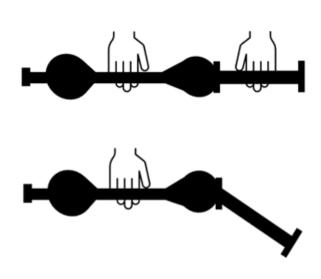



STEC.10037 10/11/2022

