

Service Information Calibrating ConAct Clutch Release System




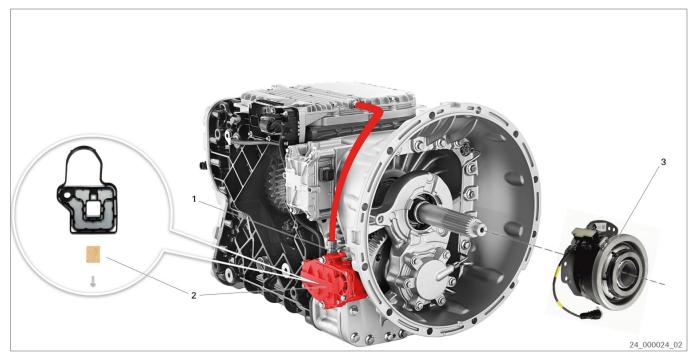


Fig. 1: Example

- 1 Air filter, coarse
- 3 ConAct clutch release system

2 Air filter, fine





Regardless of the vehicle manufacturer, the ConAct clutch release system (3) must be calibrated with a suitable diagnostic unit (e.g. diagnostic products from TEXA www.texa.com/solutions/truck) after the installation.

Observe the vehicle manufacturer specifications.

If the ConAct clutch release system (3) is not calibrated after the installation, the following errors may occur:

- Error message in display.
- Clutch grabs when setting off.
- Vehicle is poorly maneuverable when loaded.

If it is not possible to calibrate the ConAct clutch release system (3), it may be due to one of the following reasons:

- Vehicle has insufficient compressed air supply.
- Air pressure in in clutch release system is too low: air filter, coarse (1) or air filter, fine (2) are clogged.
- Vehicle software: version not up to date.



Air filter available separately: Item no. 0073.298.076 (Fig. 1: 2)


www.aftermarket.zf.com/contact



Service Information Calibrating ConAct

Clutch Release System



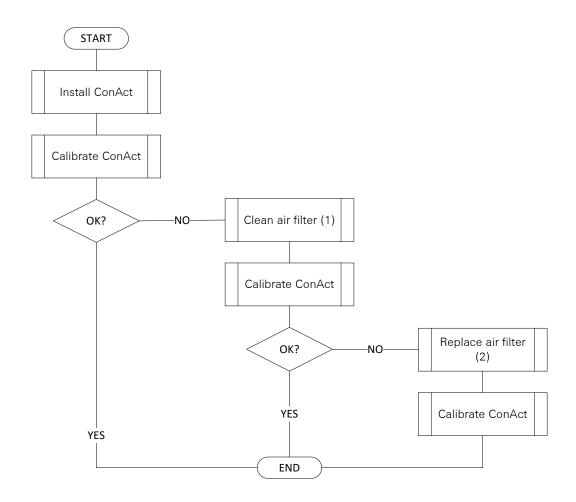



www.aftermarket.zf.com/serviceinformation